

Contains information from the DVD release notes.

KYOCERA Drivers - Known Issues

Contents

KX Driver	1
KX (XPS) DRIVER Only.....	4
KPDL and PCL Mini-drivers Only	5
Fax / Scan Driver Only	6

KX Driver

1. If the KX DRIVER is uninstalled immediately after installation, the uninstallation fails.
Solution: Restart the PC and uninstall the KX DRIVER.
2. Status Monitor is not available from the client side in a server-client environment on Microsoft Windows Server 2000, 2003, 2008, 2008 R2 and 2012.
3. The color of characters printed larger than 72 point differs from smaller characters when “Download as bitmaps” is selected in Font Settings.
Solution: Change the font setting in the Imaging tab of Printing Preferences to “Download as outline”.
4. On Windows Terminal Server and Cluster Server, features normally installed by Optional Components Wizard are not available. This affects Output to PDF, Color Optimizer, Security Watermark, Common Profiles and other extended Driver functions.
5. When printing from a 32bit application running on a 64bit Windows operating system with Job Accounting enabled, no account codes are sent to the print device and the device displays an “Invalid Account Code” error message.
Solution: Enable the “Print directly to the printer” option in the Advanced tab of Printer Properties, or use a 64bit version of the application.

Contains information from the DVD release notes.

6. Status Monitor may either not launch or not display all the contents of the window if a user tries to print immediately after turning on the computer.
Solution: *Go to Control Panel > System and Security > Administrative Tools > Services*. In the Services dialog, check the status of KDSvc. If KDSvc is already running, try to print again after a few minutes. If the KDSvc is not running, right-click on it and select Start.
7. Although a user has administration privileges on a machine, the user may not have admin privileges for a printer running on that machine.
Solution: Run the driver in administrator mode by choosing "Run as Administrator".
8. EMF (enhanced metafile) spooling is not supported for KPDLM printing.
9. An extra blank page prints when a Microsoft Word 2007 document is printed when both mixed paper sizes and Duplex is selected. This is a known limitation in Word 2007.
10. Some objects in PowerPoint 2007 do not print in Poster mode for 3x3 pages or more. This is a known limitation in PowerPoint 2007.
11. In Vista, Windows 7 and Windows 8 Custom Paper Size is missing from the Paper Size list of Windows Photo Gallery/Photo Viewer. This is a known limitation in the Photo Printing Wizard (PPW) application.
12. Interactive services dialog detection messages pop-up when printing mixed sized documents in booklet mode on the 64-bit version of Vista.
13. When adding a 32-bit driver to a shared printer on a server running a 64-bit version of Windows, the model name may appear multiple times in Share this Printer.
Solution: To avoid displaying multiple model names, choose "Have Disk" when using the "Additional Drivers..." option and browse to the x86 driver INF file for the desired model to install it.
14. KPDLM pass through mode fails for some Adobe products. This is a known limitation in Adobe products on Vista, Windows 7 and Windows 8.
15. The ICM profile is not installed automatically.
Solution: If your specific color printing needs require the ICM profile, please install it manually using Properties --> Color Management --> Add... .
16. When printing from 64-bit Adobe applications such as Acrobat Reader in KPDLM pass through mode, watermarks will not print.
17. Application-based printing is not supported on 64-bit versions of Windows.
18. Smart duplex printing is not supported in booklet mode.

Contains information from the DVD release notes.

19. Print Preview is not supported for KPD L pass through mode with applications like Adobe Acrobat.
20. The following advanced driver settings will not be displayed on the Print Preview: outer n-up borders, poster assembly marks, 180-degree rotation, color adjustment, gutter, EcoPrint, Prologue/Epilogue.
21. A blank page is printed when printing multiple complex pages with Print Preview, GDI compatible mode, and 16-up and higher selected at the same time.
Solution: Turn off Print Preview to print correctly.
22. "Interactive Services" dialog displays in some cases with Print Preview, such as manual duplex in Vista. While Print Preview dialog is active for one document, all other open documents of the same application cannot be accessed. This is a known limitation in Windows.
Solution: Close the Print Preview dialog to access the other open documents.
23. Grid lines may appear on some images in Print Preview because of moiré effects. However it will not affect the output.
24. KPD L Pass-through mode does not work when PDL is changed from within an application.
Solution: Close the application, change the PDL mode in the Device Settings tab, then reopen the application.
25. Lower panel will not be displayed when Y screen resolution is less than 864.
26. On a 64-bit Windows OS, Smart Duplex printing may not work with some 32-bit applications, including Microsoft Word and Excel.
Solution: Install the 64-bit version of the application to use Smart Duplex printing on your 64-bit OS.
27. On a 64-bit Windows OS, the Microsoft Outlook policy in Active Directory and Policy
28. Manager does not take effect for Microsoft Outlook (32-bit).
Solution: Install the 64-bit version of Microsoft Outlook for the policy to take effect on your 64-bit OS.
29. When "Create from application settings" is selected for booklet mode, the pages might not be displayed correctly in Print Preview.
30. In the 32-bit version of Windows 8, Application-based Profiles are not supported for Microsoft Word and Microsoft Excel. This is due to architectural changes in Windows 8.

Contains information from the DVD release notes.

KX (XPS) DRIVER Only

1. Some advanced XPS features are not available when printing from GDI-based applications such as Office 2007. These are known limitations of the Microsoft XPS Document Writer (MSDW).
2. Kyocera driver plug-ins, such as Security Watermark and Output to PDF, are not supported by the KX (XPS) DRIVER.
3. The Prologue/Epilogue feature is not supported.
4. This driver supports only XPS supported printer hardware. It will not work with KPDL, PCL XL, or PCL 5.
5. Because of a file limitation in the XPS container, printing hundreds of copies of a multi-page print job might result in an invalid XPS file.
Solution: Split the copies into multiple print jobs.
6. When mixed paper size document is printed with N-up, the output paper size is incorrect.
7. Additional white space prints at the bottom of a page when printing multiple pages per sheet with Gutter enabled.
8. KX (XPS) DRIVER did not upgrade.
Solution: Uninstall the earlier KX (XPS) DRIVER and install the KX (XPS) DRIVER.
9. KX (XPS) Driver cannot print jobs from hosts running Windows Server 2008 and Windows Vista operating systems that do not have Platform Update installed.
Solution: Install KB971644 (Platform Update for Windows Server 2008 and Platform Update for Windows Vista) from Windows Update on your system. Service Pack 2 is required to install this update.
10. When "Save to file" is selected, XPS files cannot be generated if the device is turned off.
Solution: Turn on the device.

Contains information from the DVD release notes.

KPDL and PCL Mini-drivers Only

1. Some KPDL mini-driver features may be selected without the associated peripheral device attached to the printer.
Solution: Verify that the associated peripheral device is attached to the printer before using the feature.
2. If any of the Device Settings are manually changed in Printer Properties/Device Settings, Auto Configure support will be deactivated for those changed settings until the system is rebooted.
Solution: To activate the Auto Configure support again, reboot the system. If rebooting is not an option, reinstall the driver and wait several minutes for the Auto Configure to begin.
3. For the PCL mini-drivers, the paper size "User Defined Size" may appear in some applications as an option. Selecting this paper size will cause the printer to use a default size, such as Letter/A4.
Solution: Ignore this entry. If a custom size is needed, add a Custom Form on the Printer Server Properties dialog box.
4. Auto-configuration for Printer Memory may not function for some printers with on-board network cards.
Solution: Set the value in Printer Properties manually.
5. The "Automatically Select" option may not select the proper paper source with the matching size when documents are being printed.
Solution: This is an operating system limitation. Please select the exact paper source you want in Document Properties, or choose the "Auto" option under paper source.
6. USB connected print devices are unable to enter standby and log 0 page jobs.
Solution: Disable bidirectional support in the Ports tab of the Printer Properties window.

Contains information from the DVD release notes.

Fax / Scan Driver Only

1. A FAX number can only be registered with numerals (0,1,2...) and the following characters: " * " (asterisk) , " – " (dash), " # " (pound sign), or a " " (space).
2. After installing the WIA driver for other device models, the existing driver may downgrade to an older version. This may cause a loss of connection with the device and/or the WIA driver properties may show blank values.
Solution: Reinstall the WIA driver from the installation media that came with your device.
3. Software features that use Web services are not available when Enhanced WSD (or Enhanced WSD over SSL) is set to OFF.
Solution: Enable Enhanced WSD (or Enhanced WSD over SSL) on the device.